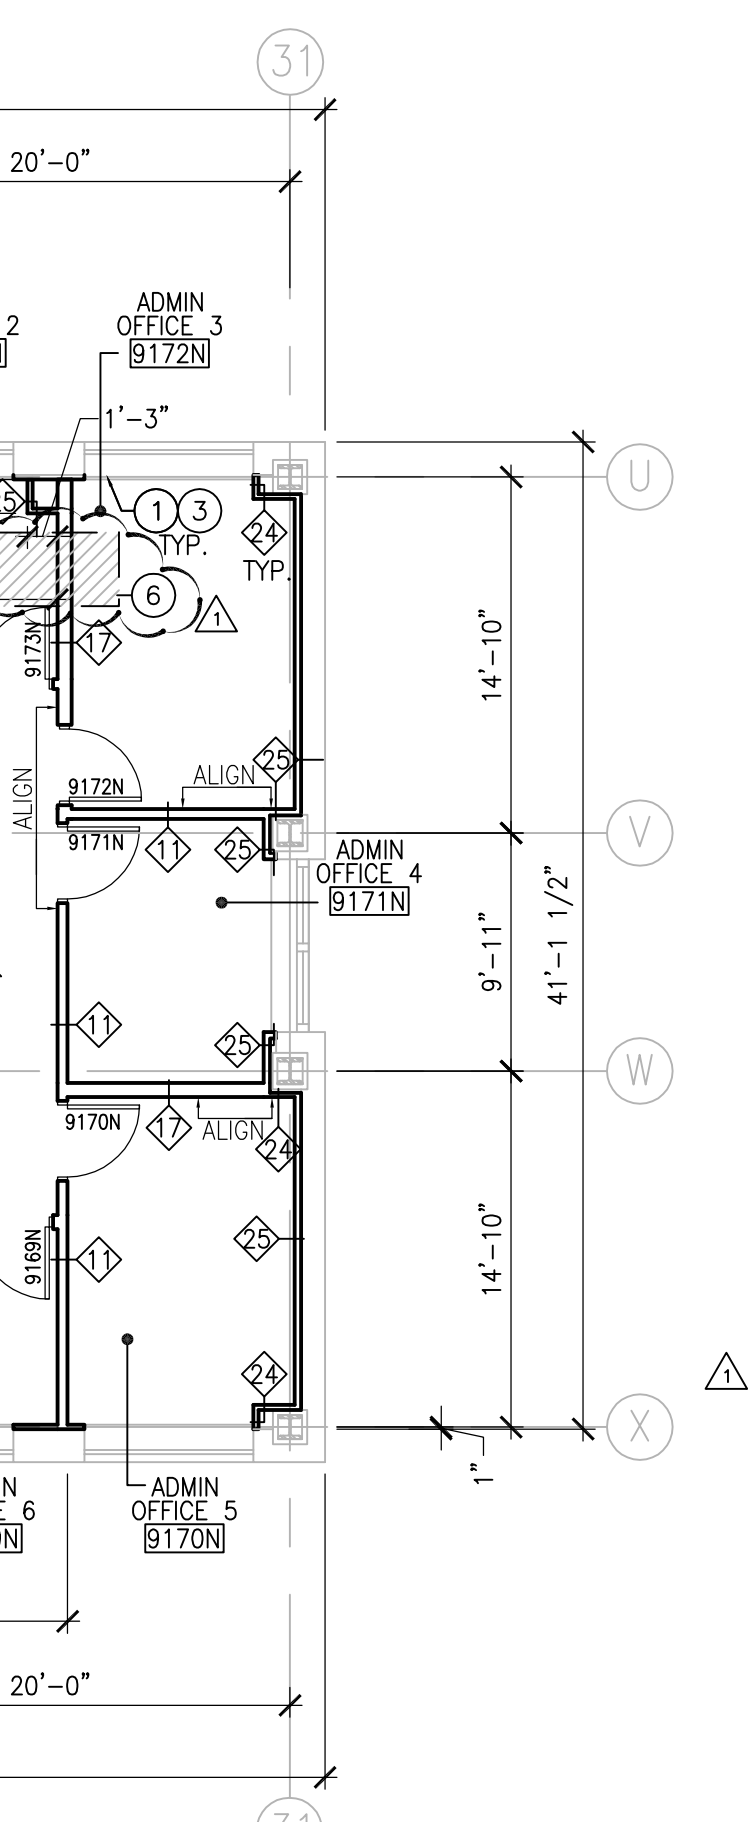


PARTITION FIRE RATING LEGEND			CONSTRUCTION PLAN LEGEND		
<div><div><div></div><div>1 HOUR FIRE</div></div><div><div></div><div>SMOKE BARRIER (1 HOUR FIRE)</div></div><div><div></div><div>2 HOUR FIRE BARRIER</div></div></div>			<div><div><div></div><div>EXISTING CONSTRUCTION TO REMAIN</div></div><div><div></div><div>NEW CONSTRUCTION</div></div><div><div></div><div>EXISTING PERIMETER WINDOW TO REMAIN</div></div><div><div></div><div>EXISTING DOOR ASSEMBLY TO REMAIN</div></div><div><div></div><div>NEW DOOR ASSEMBLY</div></div><div><div></div><div>CURTAIN TRACK (CEILING MOUNTED)</div></div><div><div></div><div>MATCH LINE</div></div></div>		
			<div><div><div></div><div>GENERAL CONSTRUCTION NOTES</div></div><div><div>1. ALL DIMENSIONS ARE TO FINISHED FACE OF PARTITION UNLESS NOTED OTHERWISE.</div><div>2. ALL DIMENSIONS SHOWN IN RENOVATED AREAS ARE TO BE VERIFIED IN THE FIELD BEFORE PROCEEDING WITH WORK.</div><div>3. WHERE A FIXED RATED PARTITION IS SHOWN ABUTTING EXTERIOR WALLS, THE FIRE RATED ASSEMBLY IS TO EXTEND TO THE EXTERIOR WALL CONSTRUCTION.</div><div>4. IN ALL ROOMS BELOW AREAS WHICH RECEIVE UNDER FLOOR SERVICES, REMOVAL OF PORTION OF EXISTING CEILING AS REQUIRED, PATCH FINISHES TO MATCH EXISTING OR AS INDICATED ON ROOM FINISH SCHEDULE.</div><div>5. REFER TO M.E.P. DRAWINGS FOR EXISTING AND NEW FIXTURES AND SERVICES TO BE REMOVED AND/OR INSTALLED. EXISTING FINISHES DISTURBED BY THIS WORK SHALL BE PATCHED TO MATCH ADJACENT UNDISTURBED FINISHES.</div><div>6. WHENEVER EXISTING EQUIPMENT, PIPING, DUCTS, ETC ARE REQUIRED TO BE REMOVED, SUCH REMOVAL SHALL INCLUDE ALL ANCHORS, HANGERS, ETC. AFTER REMOVAL, FLOORS, WALLS AND CEILINGS SHALL BE FINISHED TO MATCH ADJACENT SURFACES OR AS INDICATED ON ROOM FINISH SCHEDULE.</div><div>7. FIRESTOP W/ U.L. APPROVED SYSTEMS, ALL PENETRATIONS THROUGH NEW & EXISTING RATED CONCRETE, EXISTING MEP AT ALL OPENINGS RESULTING FROM THE RENOVATIONS OF EXISTING MEP SYSTEMS, SEE MECHANICAL, ELECTRICAL, PLUMBING & FIRE PROTECTION DRAWINGS TO DETERMINE FULL SCOPE OF WORK. REFER TO C5/1-1-AE01 AND SCHEDULE OF THROUGH PENETRATION FIRESTOP SYSTEM ON TRAPPING, 1-AE01. PENETRATION FIRESTOPPING REQUIREMENTS, CONTRACTOR TO MAINTAIN THE INTEGRITY OF THE RATED ASSEMBLY AT ALL PENETRATIONS THROUGH THAT ASSEMBLY.</div><div>8. EXAM TABLES ARE DASHED AND SHOWN FOR REFERENCE AND COORDINATION ONLY.</div><div>9. REFER TO CAD DRAWING SERIES FOR FURNITURE AND EQUIPMENT PLANS FOR REFERENCE AND COORDINATION, PROVIDING BACKUP AT ALL EQUIPMENT AND ACCESSORIES, REFER TO DETAIL E6/1-A504.</div><div>10. UNDERCUT ALL DOORS TO CLEAR NEW FLOOR FINISHES. FOR ADDITIONAL INFORMATION, REFER TO DOOR SCHEDULE ON SHEETS 1-AE03 AND 1-AE04.</div><div>11. CHOP DOWN ABANDONED EXISTING CONDUIT AND PIPES TO THE TOP OF THE STRUCTURAL SLAB, CUT CONDUITS AND PIPES AT THE TOP OF STRUCTURAL SLAB AND SEAL WITH FRESHWING BACKFILL VOID WITH LIGHT WEIGHT CONCRETE.</div><div>12. BACKFILL WITH LIGHT WEIGHT CONCRETE ALL VOIDS TOPPING SLAB RESULTING FROM REMOVAL OF PARTITIONS, SHOWER PANS AND OTHER REMOVALS.</div><div>13. FLOAT ENTIRE SLAB WITH HYDRAULIC CEMENT UNDERLAYMENT. PROVIDE BONDING AGENT.</div><div>14. REPAIR ALL DAMAGED PERIMETER WINDOWS AND ALL ASSOCIATED HARDWARE AND MECHANISMS FOR WINDOW TO FUNCTION PROPERLY, WHERE MISSING, PROVIDE OPENING RESTRICTIONS TO MATCH EXISTING AT LOCATIONS WHERE WINDOW IS BOLTED SHUT. REMOVE BOLTED ASSEMBLY, SEAL AND REPAIR WINDOWS AND MECHANISMS AS NECESSARY FOR PROPER WINDOW OPERATION. REPAIR AND/OR REPLACE ALL PERIMETER WINDOW BUNDLS AND ALL ASSOCIATED HARDWARE AND MECHANISMS TO REPAIR ALL WINDOWS.</div><div>15. REFER TO SPECIFICATION, SECTION 13.05.41 AND SYSTEMS DESIGN PARAMETERS LISTED ON SHEET 1-SJ001 FOR ALL SEISMIC BRACING REQUIREMENTS.</div><div>16. ALL INTERIOR PARTITIONS THAT STOP ABOVE THE CEILING TO BE BRACED TO THE SLAB ABOVE.</div><div>17. ALL LOOSE CONCRETE MATERIAL AROUND BEAMS AND/OR COLUMNS TO BE REMOVED, ALL BARE STRUCTURAL STEEL TO BE FIREPROOFED, ALL CRACKS TO BE FILLED WITH NON-SHRINK GROUT.</div><div>18. ALIGN THE FACE OF AN INTERIOR PARTITION WITH THE EDGE OF THE WINDOW JAMB AT LOCATIONS WHERE THE INTERIOR PARTITION MEETS THE EXTERIOR WALL ASSEMBLY, UNLESS OTHERWISE NOTED.</div></div></div>		
<div><div><div></div><div>SPECIFIC CONSTRUCTION NOTES</div></div><div><div>1. AT THE INTERIOR FACE OF WALL ALONG THE PERIMETER PROVIDE FRAMING AS SCHEDULED WITH TYPE X GYPSUM BOARD AND INSULATION.</div><div>2. PROVIDE NEW LOUVER. REFER TO F3/1-A506.</div><div>3. PROVIDE NEW CONVEXOR CONCRETE AND WINDOW SILL. REFER TO DETAIL F8/1-A506.</div><div>4. NEW CONCRETE CURB. ALIGN NEW CURB WITH EXISTING COLUMN ENCLOSURE IN PLAN. MATCH HEIGHT TO EXISTING ADJACENT CONCRETE CURB HEIGHT. REFER TO DETAIL F8/1-SJ001.</div><div>5. NEW SLAB INFILL. REFER TO DETAIL E6/1-SJ001.</div><div>6. REPAIR EXISTING CONCRETE SLAB. REFER TO DETAIL C8/1-SJ001.</div><div>7. NEW MECHANICAL SHAFT INFILL. REFER TO DETAIL E8/1-SJ001. COORDINATE WITH MECHANICAL DWGS.</div><div>8. EXISTING CONCRETE CURB TO REMAIN.</div><div>9. PROVIDE AND INSTALL EXTENSION BACK BOXES FOR ALL ELEVATOR CALL BUTTON ASSEMBLIES AND CALL LIGHTS, AND EXTEND CONDUIT AND POWER TO BE FLUSH WITH NEW FACE OF ELEVATOR WALL.</div><div>10. NEW SECURITY GRILLE. REFER TO B1/1-A502 AND C1/1-A503.</div><div>11. NEW FIRE EXTINGUISHER CABINET. REFER TO SHEET 1-A502 FOR DETAILS.</div><div>12. NEW WALL ACCESS PANEL. REFER TO B8/1-A503.</div><div>13. AT 9TH FLOOR, PAINT ALL EXPOSED PIPING WITH NEW COAT OF PAINT TO MATCH EXISTING. SPRINKLER PIPING TO BE PAINTED RED.</div><div>14. EXISTING FIRE ALARM PANEL TO REMAIN.</div><div>15. NEW 4TH HOUSEKEEPING PADS. COORDINATE LOCATION W/ MECHANICAL DRAWINGS. REFER TO DETAIL F8/1-SJ001.</div><div>16. NEW DRINKING FOUNTAIN (SEE PLUMBING DWGS).</div><div>17. NEW RADIATOR ENCLOSURE. REFER TO DETAIL F1/1-A506.</div><div>18. NEW FIN TUBE ENCLOSURE. REFER TO DETAIL B8/1-A506.</div><div>19. NEW 2HR RATED SLAB INFILL WITH OPENINGS FOR DUCTWORK. SEE MECHANICAL DWG 1-WH01 FOR ADDITIONAL INFORMATION INCLUDING FIRE DAMPER.</div><div>20. PROVIDE ACCESS PANEL IN NEW PARTITION FOR EXISTING ELECTRICAL WIRE WAY. REFER TO ELECTRICAL DRAWINGS FOR ADDITIONAL INFORMATION, COORDINATE EXACT SIZE /LOCATION WITH EXISTING EQUIPMENT.</div><div>21. PROVIDE 2 HOUR RATED ACCESS PANEL IN EXISTING PARTITION. CONTRACTOR TO VERIFY EXACT SIZE IN FIELD.</div></div></div>			<div><div><div></div><div>BUILDING IS FULLY SPRINKLERED</div></div><div><div>Scale: 1/8"=1'-0"</div></div></div>		
<div><div><div>Project Title</div><div>VA NY HARBOR HEALTHCARE SYSTEM MANHATTAN VAMC - BUILDING 1 9TH FLOOR RENOVATIONS</div></div><div><div>Location</div><div>423 EAST 23RD STREET NEW YORK, NY 10010</div></div><div><div>Date</div><div>AUGUST 15, 2013</div></div><div><div>Checked</div><div>AH/DT</div></div><div><div>Drawn</div><div>CO</div></div></div>			<div><div><div>Project Number</div><div>630PR2600</div></div><div><div>Building Number</div><div>1</div></div><div><div>Drawing Number</div><div>1-AE109-N</div></div><div><div>Office of Construction & Facilities Management</div><div><div>VA</div><div>U.S. Department of Veterans Affairs</div></div></div></div>		